Applies To: **1998–02 Accord L4** – ALL

July 16, 2002

ABS Indicator Is On With DTC 81

SYMPTOM

ABS indicator light is on with ABS DTC 81 [Central Processing Unit (CPU) Diagnosis, and ROM/RAM Diagnosis] stored.

PROBABLE CAUSE

ABS control unit malfunction.

CORRECTIVE ACTION

Replace the ABS control unit.

PARTS INFORMATION

ABS Control Unit:
P/N 39790-S84-A02, H/C 7054224

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number:	413190
Flat Rate Time:	0.3 hr
Failed Part:	P/N 39790-S84-A01 H/C 5436753
Defect Code:	032
Contention Code:	B01
Template ID:	02-040A
Skill Level:	Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Use the PGM Tester to verify that ABS DTC 81 is stored in the ABS control unit.
   - If DTC 81 is stored, go to step 2.
   - If another DTC is stored, continue with normal troubleshooting.
2. Remove the driver's kick panel.
3. Disconnect the ABS control unit connectors.

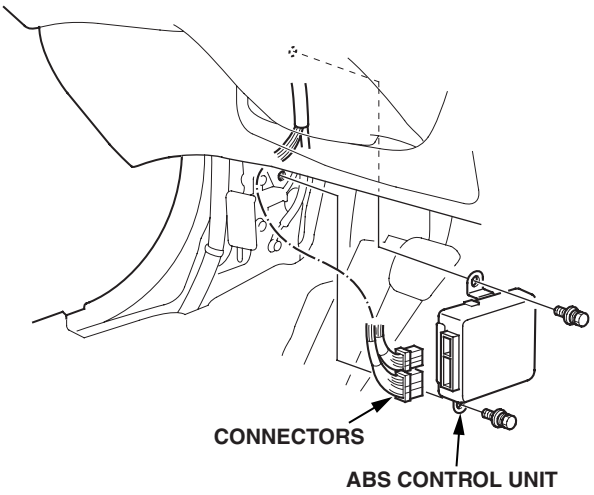

4. Remove the ABS control unit (two bolts).
5. Install the new ABS control unit. Reconnect the connectors.
6. Reinstall the driver's kick panel.
7. Check that the ABS indicator is off and the DTC is cleared.

© 2002 American Honda Motor Co., Inc. – All Rights Reserved

Skill Level
R
REPAIR

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.